



[illegible]


SAVING TITLE:

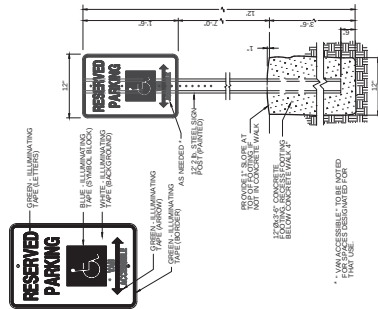

NOT TO SCALE

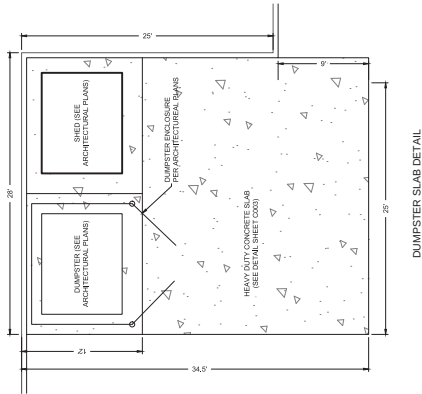


DUMPSTER SLAB DETAIL

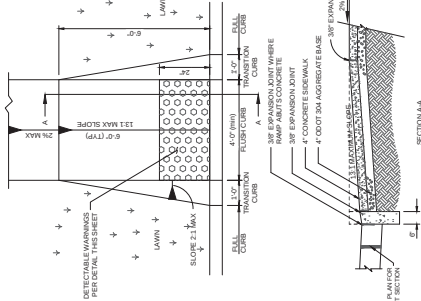

SIDEWALK RAMP


- CONCRETE SIDEWALK PER DETAIL ON SHEET C004

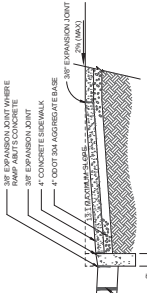

TRUNCATED DOME DETECTABLE WARNING

1. DETECTABLE WARNING SHALL BE OF THE PAVEMENT MAT TYPE WITH ADHESIVE PER MANUFACTURER'S SPECIFICATIONS
2. WIDTH OF DETECTABLE WARNING AREA SHALL BE A MINIMUM OF 4 FEET AND VARY WITH WIDTH OF RAMP
3. LENGTH OF DETECTABLE WARNING AREA SHALL BE 2 FEET REGLESS OF SECTION WIDTH
4. DETECTABLE WARNING AREA CAN BE SQUARE WHERE USED IN A CURB RADIUS
5. DETECTABLE WARNING DOMES SHALL BE ALIGNED ON A SQUARE GRID IN THE DOMINANT DIRECTION OF TRAVEL TO PREVENT WHEELS TO ROLL BETWEEN DOMES
6. DETECTABLE WARNING AREA SHALL BE A CONTRASTING COLOR IN ALL LOCATIONS

LAMINATED DOME SPACING

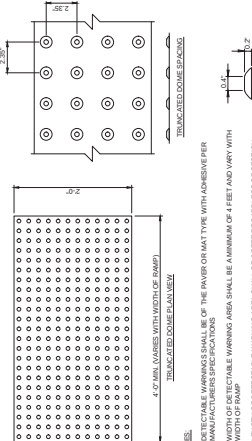[illegible]

DATE:	09/28/17
DRAWN BY:	MTP
CHECKED BY:	BJM
JOB NUMBER:	2016.00666

C004

MOTEL 6/STUDIO 6
5550 TUTTLE CROSSING BLVD
DUBLIN, OH 43017


MOODY•NOLAN

300 Spruce Street
Suite 300
Columbus, Ohio 43215
Phone: (614) 461-4664
Fax: (614) 280-8881
www.moodyindian.com

SAVING TIME &

SITE DETAILS

09/18/	
--------	--



C004

UNIVERSITY SET

FRANKLIN COUNTY, DUBLIN, OHIO
PLOT, GRADE AND UTILITY PLAN
FOR
5550 TUTTLE CROSSING
MOTEL 6

MOTEL 6



**AMERICAN
STRUCTUREPOINT
INC.**

2250 Corporate Exchange Drive | Suite 300
Columbus, Ohio 43231
TEL 614.901.2235 | FAX 614.901.2236
www.structurepoint.com

NO.	DATE	CHANGE DESCRIPTION


MOTEL 6/STUDIO 6
5550 TUTTLE CROSSING BLVD
DUBLIN, OH 43007

MOODY•NOLAN
300 Spicard Street
Phone: (614) 461-5664
www.moody-nolan.com
Columbus, Ohio 43215

GRADING PLAN

DATE: 08/15/2017
PROJECT NO.: 2016.00863
SHEET NO.: C300

BOOKEND SET

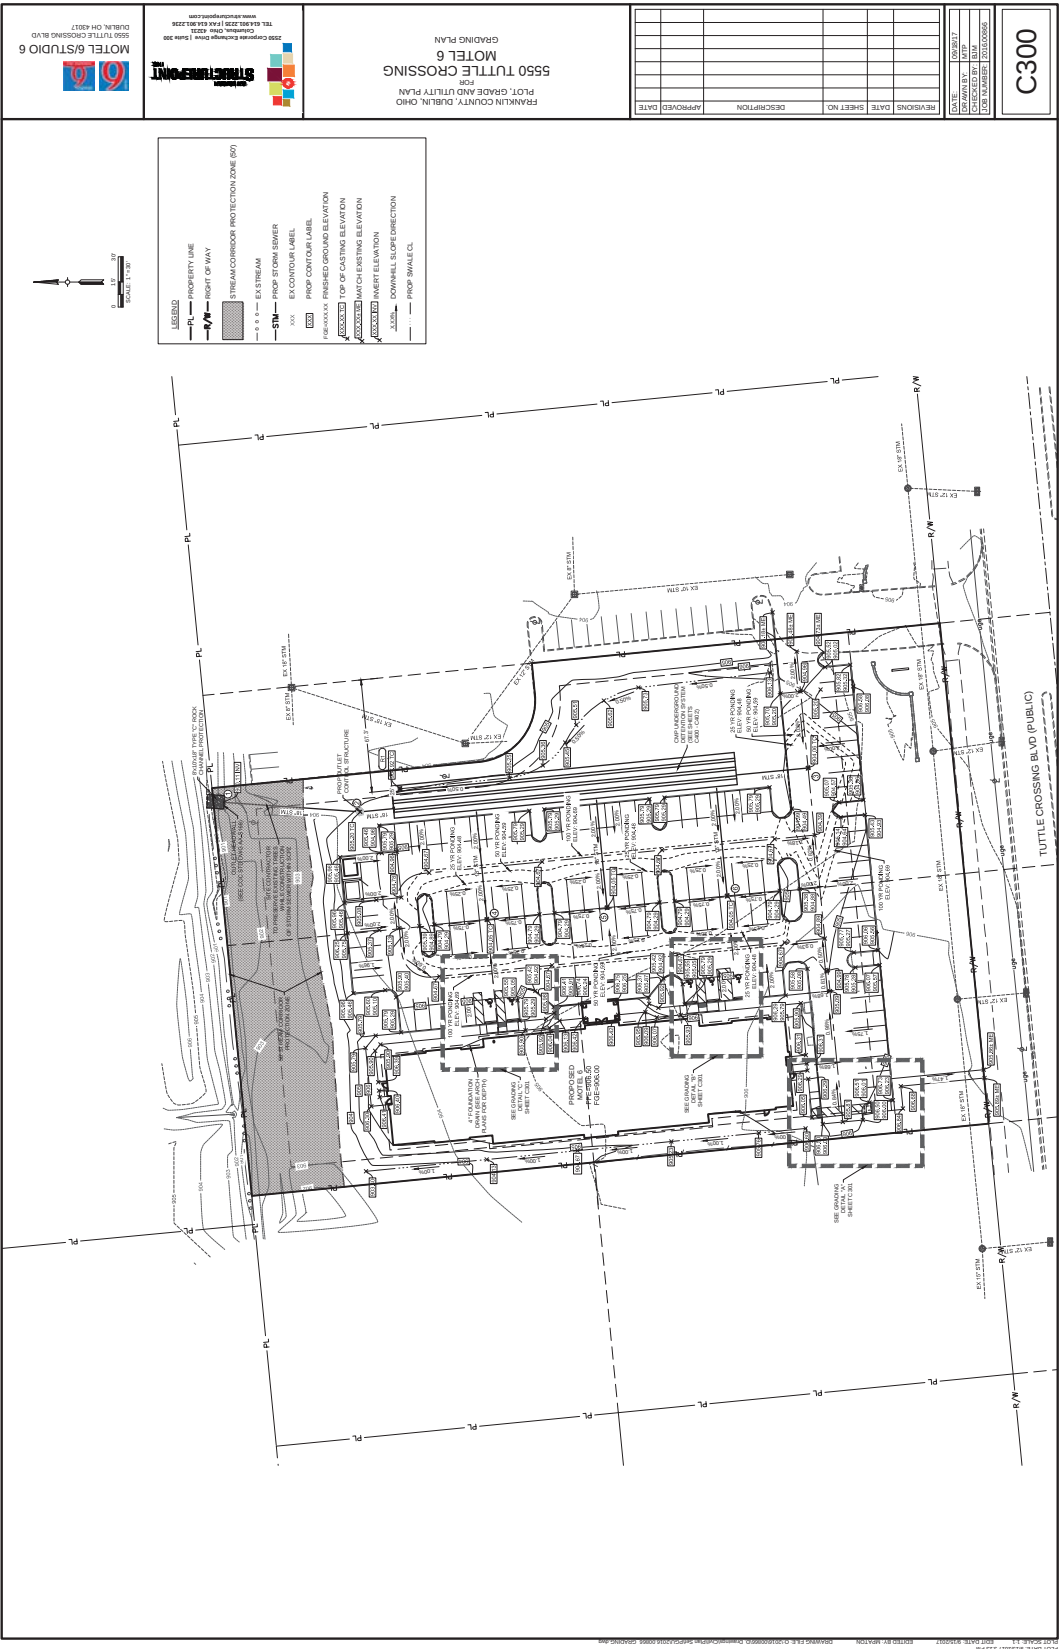

MOTEL 6/STUDIO 6
5550 TUTTLE CROSSING BLVD
DUBLIN, OH 43007

STRUCTUREPOINT
INC.
2250 Corporate Exchange Drive | Suite 300
Columbus, OH 43260
TEL: 614.330.2250 FAX: 614.330.2256
www.structurepoint.com

FRANKLIN COUNTY, DUBLIN, OHIO
PLOT, GRADE AND UTILITY PLAN
FOR
MOTEL 6
5550 TUTTLE CROSSING
GRADING PLAN

REVISIONS	DATE	SHEET NO.	DESCRIPTION	APPROVED	DATE

MOTEL 6/STUDIO 6
5550 TUTTLE CROSSING BLVD
DUBLIN, OH 43007

C300



GRADING DETAILS

DATE: 08/15/2017
PROJECT: 11 EAST 9TH ST, DUBLIN, OH 43017
SHEET: 2018.00860

C301

BOOKEND SET



NO.	DATE	CHANGE DESCRIPTION
1		
2		
3		
4		
5		

FRANKLIN COUNTY, DUBLIN, OHIO
PLOT, GRADE AND UTILITY PLAN
FOR
MOTEL 6
5550 TUTTLE CROSSING




TOP VIEW
KEY PLAN



C301

DATE	DESCRIPTION
08/15/2017	DESIGN
08/15/2017	CHECKED BY: J. H. HARRIS
08/15/2017	DATE: 08/15/2017

REVISIONS	DATE	DESCRIPTION	SHEET NO.	APPROVED	DATE
1					
2					
3					
4					
5					


FRANKLIN COUNTY, DUBLIN, OHIO
PLOT, GRADE AND UTILITY PLAN
FOR
MOTEL 6
5550 TUTTLE CROSSING

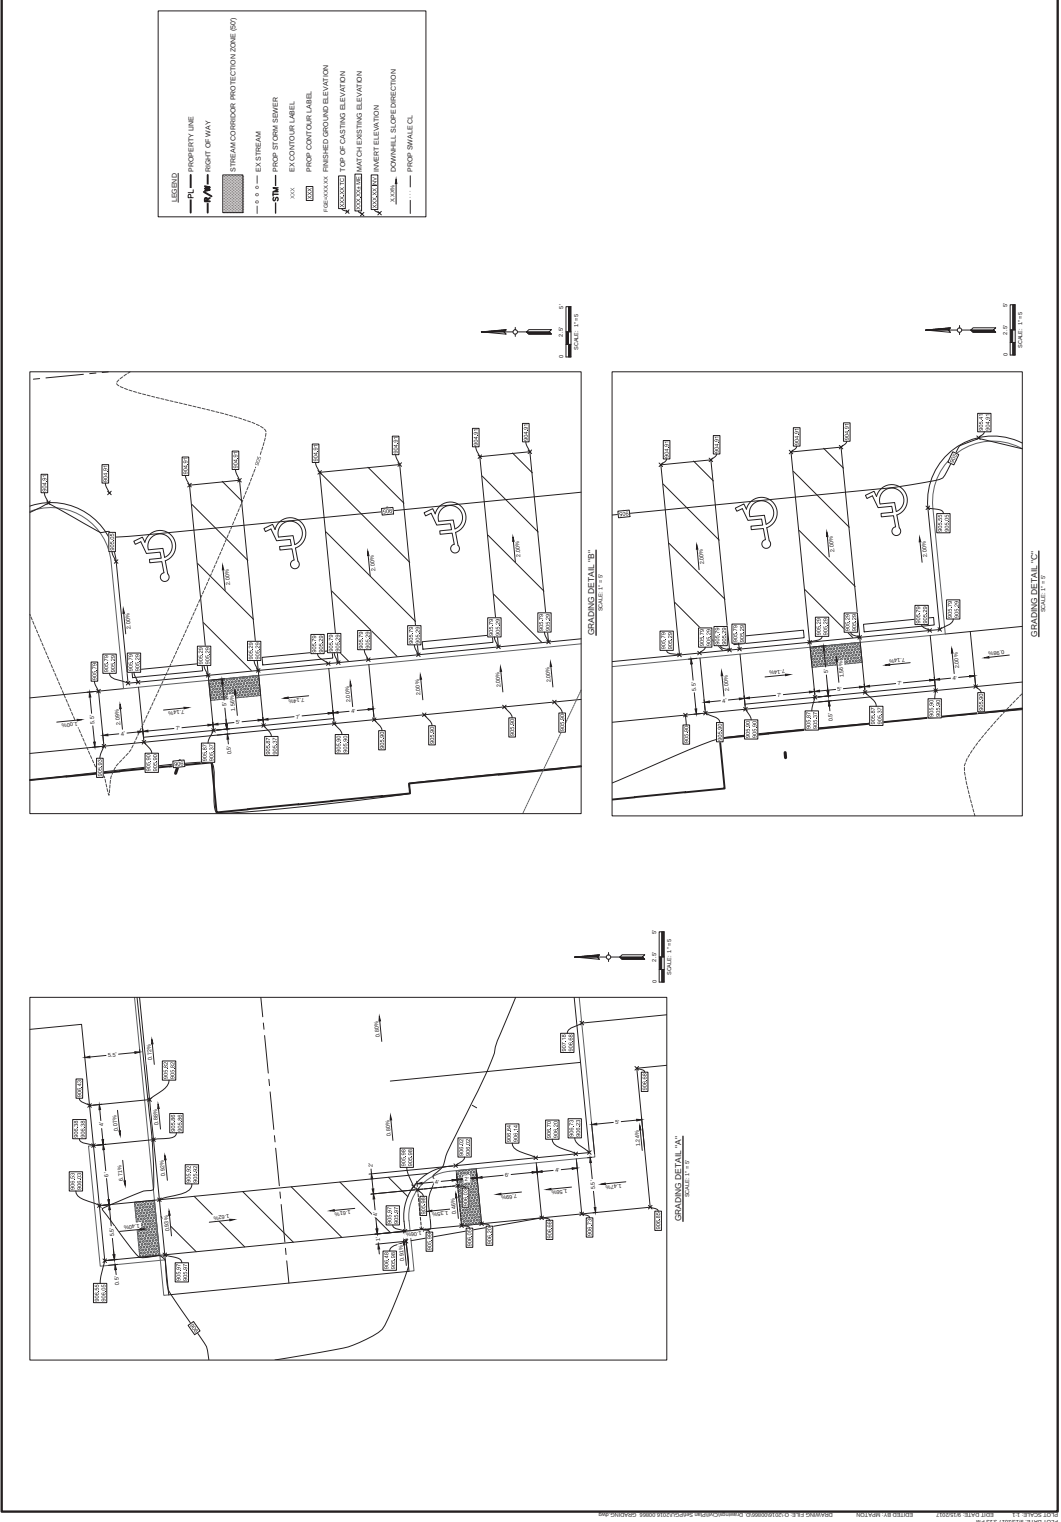

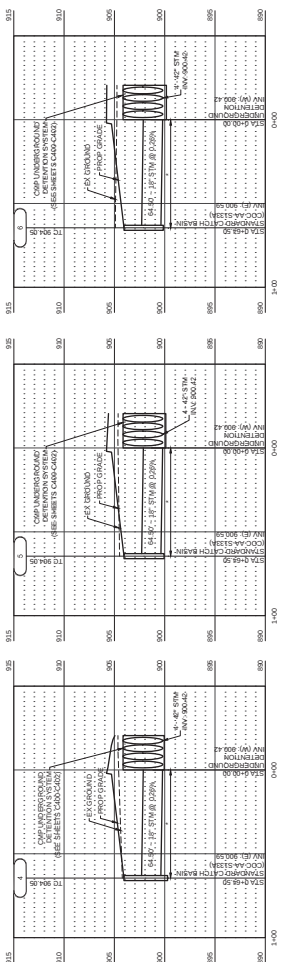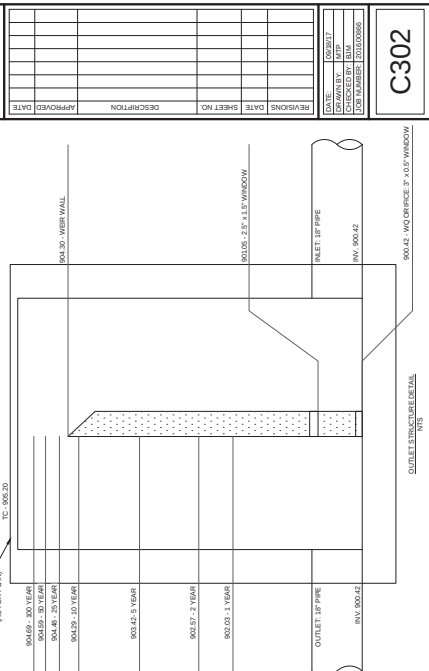

STORM SEWER STRUCTURE TABLE		EASTING	
STRAINAGE	STRUCTURE TYPE	NORTHING	
1	STANDARD CATCH BASIN (COC AS 53.08)	759787.0	1779954.00
2	STANDARD CATCH BASIN (COC AS 53.08)	759752.00	1779740.00
3	STANDARD CATCH BASIN (COC AS 53.3A)	759648.00	1779797.40
4	STANDARD CATCH BASIN (COC AS 53.3A)	759665.87	17797688.00
5	STANDARD CATCH BASIN (COC AS 53.3A)	759669.23	1779787.00
6	STANDARD CATCH BASIN (COC AS 53.3A)	759648.00	17797999.07
7	STANDARD CATCH BASIN (COC AS 53.3A)	759648.00	17797962.00

STORM SEWER PROFILES MOTEL 6 5550 TUTTLE CROSSING FOR PLOT, GRADE AND UTILITY PLAN FRANKLIN COUNTY, OHIO		2020 Corporate Exchange Drive 154th 200 TEL: 614.931.2229 FAX: 614.931.2236 Columbus, Ohio 43228 www.cpscandp.com	
 STRUTCHFIELD CONSULTING		 MOTEL 6	
5550 TUTTLE CROSSING BLVD DUBLIN, OH 43017		5550 TUTTLE CROSSING BLVD DUBLIN, OH 43017	

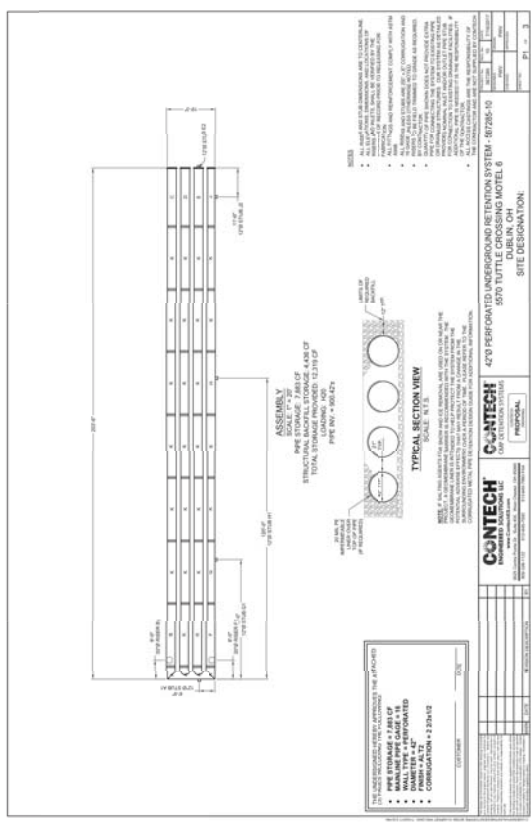

C400		DATE: 02/26/17 DRAWN BY: BMM CHECKED BY: BMM JOB NUMBER: 101000666
REVISIONS	DATE	SHEET NO.
DESCRIPTION		
APPROVED	DATE	

FRANKLIN COUNTY, DUBLIN, OHIO
PLOT, GRADE AND UTILITY PLAN
FOR
5550 TUTTLE CROSSING
MOTEL 6
CONTECH UNDERGROUND DETENTION



**AMERICAN
STRUCTUREPOINT
INC.**

2250 Corporate Exchange Drive | Suite 300
Columbus, Ohio 43231
TEL 614.901.2235 | FAX 614.901.2216
www.structurepoint.com

FRANKLIN COUNTY, DUBLIN, OHIO
PLOT, GRADE AND UTILITY PLAN
FOR
5550 TUTTLE CROSSING
MOTEL 6

[illegible]

MOTEL 6/STUDIO 6
5550 TUTTLE CROSSING BLVD
DUBLIN, OH 43017

MOODY•NOLAN

300 Spruce Street
Suite 300
Columbus, Ohio 43215

Phone: (614) 461-4664
Fax: (614) 281-8881
www.moody-nolan.com


CONTECH UNDERGROUND
DETENTION

2016 009866

C400

BOYERHART SET

STATE OF OHIO
BENJAMIN
HALLER
E-710864
PROSECUTOR GENERAL

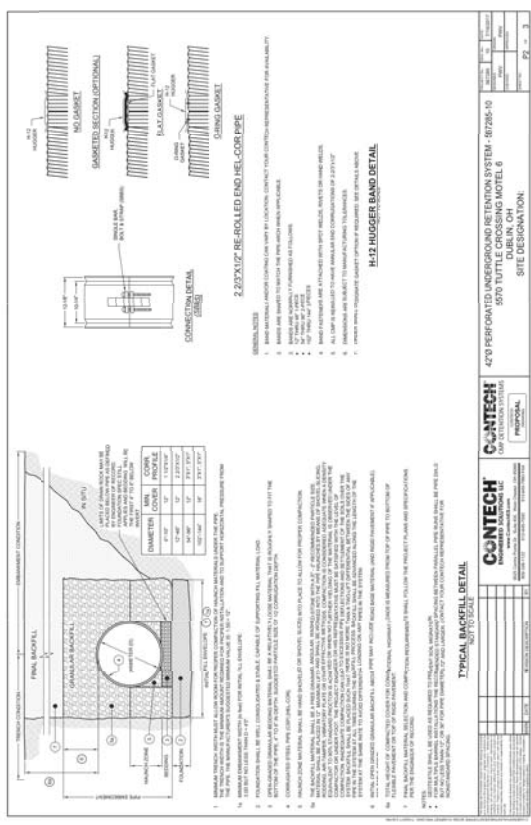


[illegible]





- A PERMANENT METAL SIGN OF 6"x11" MUST BE FIRMLY BANNED AT THE FIRE DEPARTMENT CONNECTION RINGER WITH LETTERS OR NUMBERS, A MINIMUM OF 2 INCHES IN HEIGHT, WITH THE FOLLOWING:
- A. "FDC" WITH THE NUMBERS OF THE ADDRESS OR ADDRESS RANGE THAT THE FIRE DEPARTMENT CONNECTION SUPPLIES.
 - B. THE BACKGROUND COLOR SHALL BE RED, WITH WHITE LETTERS.
 - C. INDICATE THE PRESSURE REQUIRED TO DELIVER THE GREATEST SYSTEM DEMAND.

[illegible]

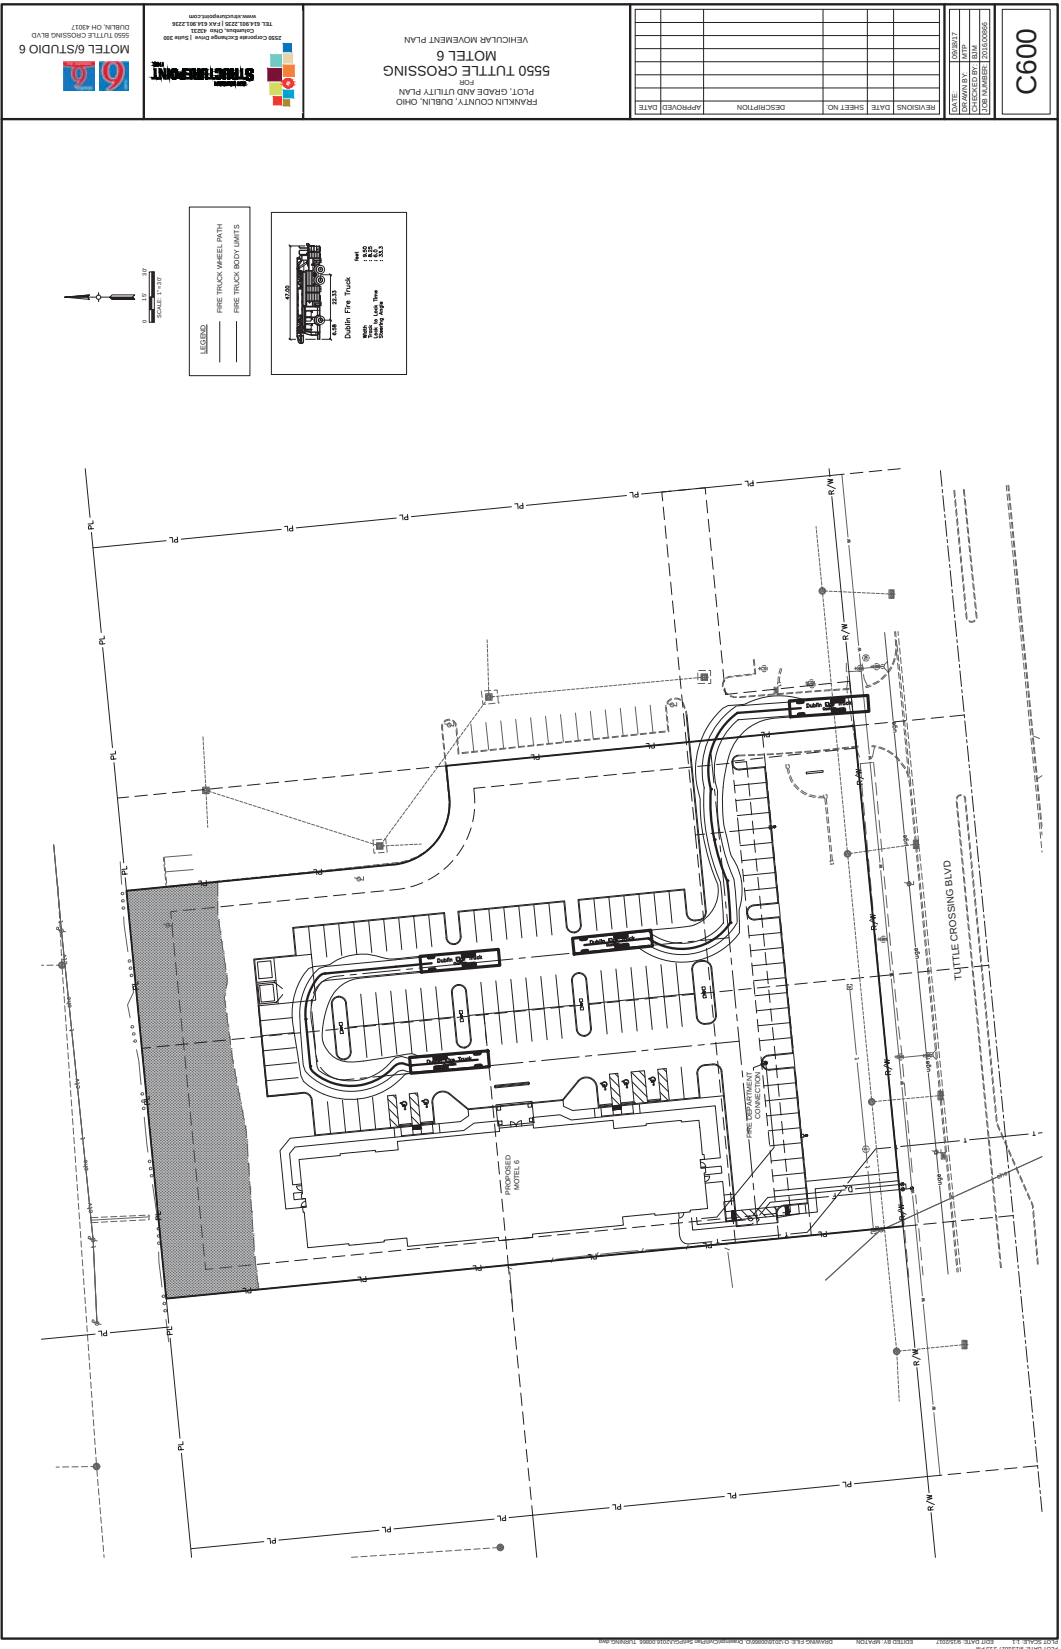

C600	
DATE:	09/18/2017
DESIGN:	BY: RLM
CHECKED BY:	RLM
DATE:	09/18/2017
PROJECT NO.:	2018.00860
SHEET NO.:	1
DATE:	09/18/2017
REVISIONS:	
DATE:	
DESCRIPTION:	
SHEET NO.:	
APPROVED:	
DATE:	

FRANKLIN COUNTY, DUBLIN, OHIO
PLOT, GRADE AND UTILITY PLAN
FOR
MOTEL 6
VEHICULAR MOVEMENT PLAN

2250 Corporate Exchange Drive | Suite 300
Dublin, Ohio 43017
TEL: 614.330.2226 FAX: 614.330.2226
WWW.AIRSTRUCTUREPOINT.COM

STRUCTUREPOINT
AIRBORNE
STRUCTUREPOINT
INC.

MOTEL 6/STUDIO 6
5550 TUTTLE CROSSING BLVD
DUBLIN, OH 43017

**VEHICULAR
MOVEMENT PLAN**

DATE: 09/18/2017
BY: RLM
CHECKED BY: RLM
DATE: 09/18/2017
PROJECT NO.: 2018.00860
SHEET NO.: 1

C600

BOOKEND SET



MOODY•NOLAN
300 Spicard Street
Phone: (614) 461-6664
www.moody-nolan.com
Dublin, OH 43017

MOTEL 6/STUDIO 6
5550 TUTTLE CROSSING BLVD
DUBLIN, OH 43017

FRANKLIN COUNTY, DUBLIN, OHIO
PLOT, GRADE AND UTILITY PLAN
FOR
MOTEL 6
5550 TUTTLE CROSSING

STRUCTUREPOINT
AIRBORNE
STRUCTUREPOINT
INC.

2250 Corporate Exchange Drive | Suite 300
Dublin, Ohio 43017
TEL: 614.330.2226 FAX: 614.330.2226
WWW.AIRSTRUCTUREPOINT.COM

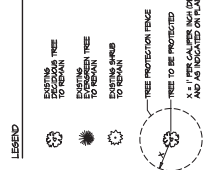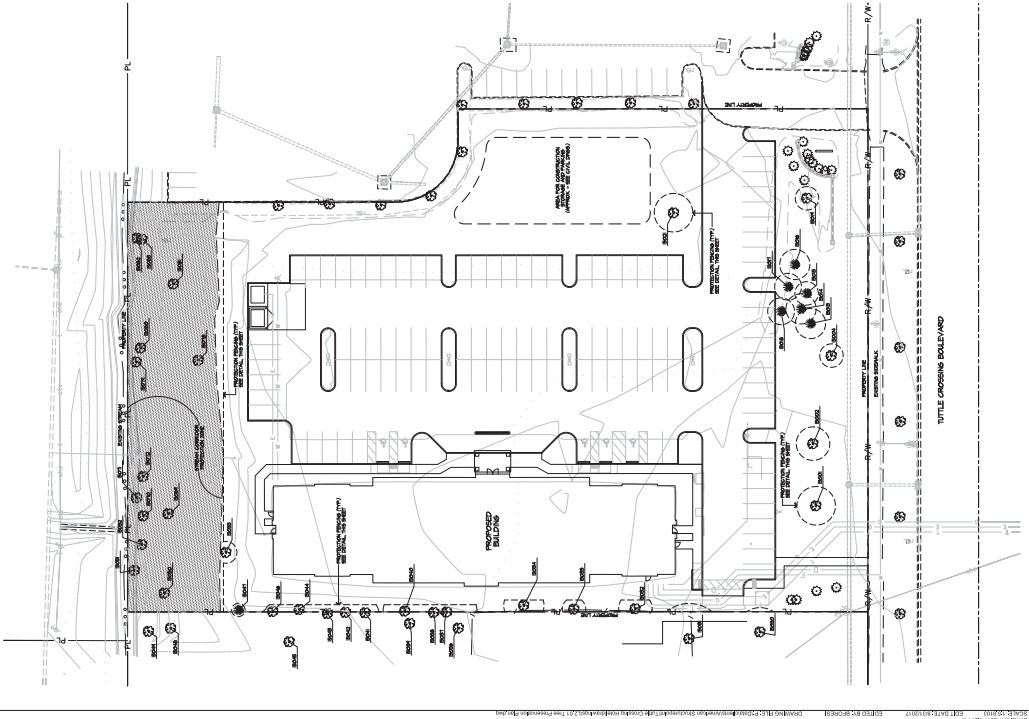

GENERAL NOTES

- ALL TREES IN THE CONSTRUCTION AREA NOT SPECIFICALLY DEMANDATED FOR REMOVAL SHALL BE PROTECTED AND PRESERVED TO REMAIN.
- OWNER SHALL BE RESPONSIBLE FOR THE CONSTRUCTION, ERECTION AND MAINTENANCE OF PROTECTION FENCING.
- THE PLANNING DEPARTMENT SHALL REVIEW AND APPROVE ALL PHASES OF CONSTRUCTION, ANY CHANGE IN THE PROTECTIVE FENCING MUST BE APPROVED BY THE PLANNING DIRECTOR.
- ALL TREES SHALL BE PLANTED TO THE SAME SPECIES AND SIZE CLASS AS THE TREE BEING REMOVED WITHIN 60 DAYS OF THE REMOVAL DATE.
- TREES REMAINING ARE TO BE FERTILIZED AND PRUNED IF NEEDED TWO YEARS AFTER CONSTRUCTION.

TREE SURVEY CHART (PRESERVED TREES ONLY)				
TREE NUMBER	DBH	COMMON NAME	SPECIES	CONDITION
10001	25	SPREEDASH	Liquidambar styraciflua	GOOD
10002	20	SPREEDASH	Liquidambar styraciflua	FAIR
10003	14	SILVER MAPLE	Aster asacanthum	GOOD
10004	14	SILVER MAPLE	Aster asacanthum	GOOD
10005	4	NORWAY SPRUCE	Thuja occidentalis	GOOD
10006	1	NORWAY SPRUCE	Thuja occidentalis	GOOD
10007	1	NORWAY SPRUCE	Thuja occidentalis	GOOD
10008	4	NORWAY SPRUCE	Thuja occidentalis	GOOD
10009	6	NORWAY SPRUCE	Thuja occidentalis	GOOD
10010	14	OAK	Quercus sp.	FAIR
10011	25	SILVER MAPLE	Aster asacanthum	FAIR
10012	42	SILVER MAPLE	Aster asacanthum	FAIR
10013	20	HALIBERRY	Norma sp.	FAIR
10014	14	SILVER MAPLE	Aster asacanthum	POOR
10015	24	SILVER MAPLE	Aster asacanthum	FAIR
10016	25	SILVER MAPLE	Aster asacanthum	POOR
10017	25	SILVER MAPLE	Aster asacanthum	VERY POOR
10018	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10019	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10020	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10021	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10022	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10023	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10024	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10025	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10026	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10027	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10028	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10029	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10030	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10031	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10032	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10033	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10034	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10035	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10036	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10037	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10038	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10039	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10040	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10041	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10042	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10043	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10044	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10045	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10046	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10047	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10048	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10049	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10050	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10051	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10052	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10053	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10054	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10055	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10056	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10057	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10058	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10059	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10060	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10061	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10062	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10063	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10064	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10065	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10066	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10067	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10068	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10069	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10070	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10071	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10072	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10073	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10074	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10075	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10076	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10077	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10078	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10079	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10080	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10081	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10082	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10083	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10084	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10085	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10086	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10087	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10088	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10089	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10090	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10091	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10092	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10093	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10094	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10095	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10096	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10097	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10098	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10099	24	SILVER MAPLE	Aster asacanthum	VERY POOR
10100	24	SILVER MAPLE	Aster asacanthum	VERY POOR



TREE PRESERVATION PLAN

EDGE

PLANNING • LANDSCAPE ARCHITECTURE • URBAN DESIGN

330 WEST SPRING STREET, SUITE 350
COLUMBUS, OHIO 43215
614-486-3343



L2.01

MOTEL 6/STUDIO 6
5550 TUTTLE CROSSING BLVD
DUBLIN, OHIO 43017

STRUCUTUREPOINT INC.
2880 Corporate Exchange Drive, Suite 200
Columbus, Ohio 43228
TEL: 614-486-3343
WWW.STRUCUTUREPOINT.COM

STRUCUTUREPOINT INC.
2250 Corporate Exchange Drive, Suite 300
Columbus, Ohio 43221
TEL: 614-486-3343
WWW.STRUCUTUREPOINT.COM

#	DATE	CHANGE DESCRIPTION

MOTEL 6/STUDIO 6
5550 TUTTLE CROSSING BLVD
DUBLIN, OHIO 43017

MOODY•NOLAN
300 Sproul Road
Columbus, Ohio 43215
Phone: 614-486-3343
www.moody-nolan.com

STRUCUTUREPOINT
TREE PRESERVATION PLAN

09/16/2017
2016.0066
L2.01
BED PERMIT SET

SEAL OF THE CITY OF COLUMBUS
OFFICE OF THE PLANNING DIRECTOR
COLUMBUS, OHIO

L3.01

